

Schlebach Quadro

HIGH EAVE TRANSITION

- 1.) Determine location of zee closure. Apply sealant tape to flat of panel.
- 2.) Place closure on top of sealant tape. Clamp back-up angle to bottom of panel. Secure through tape and panel with #12-14 x 1" HWH Tek/3 fastener @ 4"oc. Seal the tab of the closure to the side joints with butyl sealant.
- 3.) Apply a continuous strip of sealant tape to the top of the zee closure. Seal between ends of tape with butyl sealant.
- 4.) Install the transition trim. Secure to closure zee with 1/4-14 x 7/8" HWH Tek/1 fasteners at 12"oc.
- 5.) Fill open hem of counter flash with urethane sealant. Interlock the two trims and secure counter flash to wall with the appropriate fastener.

